CARLO GAVAZZI

Sx Tool Download

Instructions



Download the **Sx Tool** from this link:

We always suggest upgrading your system to the latest software release



Scarica Sx Tool da questo link:

Consigliamo di effettuare sempre l'aggiornamento del sistema alla versione più recente del software



Télécharger le Sx Tool de ce lien :

Nous vous suggérons de toujours mettre à jour votre système avec la plus récente version du logiciel

voroion du

Descargar el **Sx Tool** desde este enlace:

Le sugerimos que actualice siempre su sistema a la última versión del software



Laden Sie die **Sx Tool**, von diesem Link:

Wir empfehlen Sie, Ihr System immer auf die neueste Software-Version zu aktualisieren

!! Tips & Tricks

See the pages below Vedere le pagine seguenti Voir les pages suivantes Véase a continuación Siehe unten

History

Release version: Official

Release name: 7.9.37 22051001-R922

Download: SA Tool SB Tool

SBP Tool → **CLICK HERE**

SH Tool

Release version: Official

Release name: 7.9.35 21102502-R919

Download: SA Tool SB Tool

SBP Tool → **CLICK HERE**

SH Tool

Release version: Official

Release name: 7.9.34 21051901-R918

Download: SA Tool SB Tool

SBP Tool → <u>CLICK HERE</u>

SH Tool

Release version: Official

Release name: 7.9.33 21032402-R917

Download: SA Tool

SB Tool

SBP Tool → **CLICK HERE**

SH Tool

Release version: Official

Release name: 7.9.32 21022501-R916

Download: SA Tool

SB Tool

 $\textbf{SBP Tool} \rightarrow \underline{\textbf{CLICK HERE}}$

SH Tool

Release version: Official

Release name: 7.9.31 20122301-R915

Download: SA Tool

SB Tool

 $\textcolor{red}{\textbf{SBP Tool}} \rightarrow \textcolor{red}{\textbf{CLICK HERE}}$

SH Tool

Release version: Official

Release name: 7.8.37 20063001-R909

Download: SA Tool

SB Tool
SBP Tool
SH Tool

Release version: Official

Release name: 7.8.36 20030401-R905

Download: SA Tool

SB Tool SBP Tool SH Tool

Older versions are available here: **Download link**



Tips & Tricks

Index

Smart building system Sx2WEB24	2
Energy save timer is not reloaded when the light level is above the threshold	2
Reports created from web App shows wrong month	3
Not possible to edit calendar activity from the web App	4
Not possible to log additional function status in the Database	4
Wrong icons shown in the web App	5
Not possible to scan the DALI network "subnet not found" error message appears	6
Dupline temperature regulation function deactivates the heating setpoint	7
Calendar activities cannot be added	8
Configuration upload failing – Intruder alarm function and stress lights	9
How to add a WEBCAM on ownControl App	10
Download button is not available	11
Download configuration shows 100% but the modules icons are not updated	12

Smart building system Sx2WEB24

Energy save timer is not reloaded when the light level is above the threshold


Problem description

The automation of the light function puts together lux meter, PIR and energy save timer. When the lux value is below the threshold and the PIR detects movement, the light goes on. At this point the lux value goes above the threshold and the energy save timer is not reloaded anymore, therefore the light goes off even if there is presence in the room.

Solution


Create an external analogue comparator that is used to define the "dark" condition.

Use the comparator function as input of a multigate "AND" function combined with the *movement signal* of the PIR sensor.

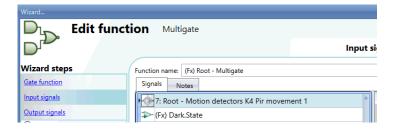




Use the multigate as input signal (On/Off Signals tab) of the Light function.

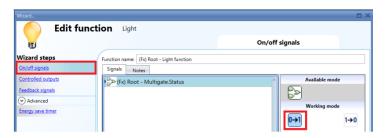

In the light function, add the presence signal of the PIR.

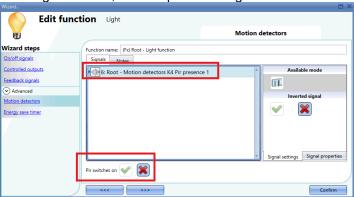

Reports created from web App shows wrong month

Problem description

In the web app *Reports* window, you have created a template for a report in October 2018 but when you save and create the report, November 2018 data logs are shown.

Solution

You may face this issue if you run a Web browser with Norwegian or Chinese language.

The problem is due to the wrong default language that is automatically set by the Web App.

To fix this issue, navigate the web App settings, select the English language, then select again the correct language and save to apply the settings.





Not possible to edit calendar activity from the web App

Problem description

When you try to edit a calendar activity from the Web App, you get an error and the login page is shown.

Solution

You may face this issue if you run a Web browser with Norwegian or Chinese language.

The problem is due to the wrong default language that is automatically set by the Web App.

To fix this issue, navigate the web App settings, select the English language, then select again the correct language and save to apply the settings.



Not possible to log additional function status in the Database


Problem description

In the Database window, the additional function status of a function is not available and it is not possible to log them into the Database of the system.

Solution

This procedure has to be followed in order to log the addition status of the functions in the Database (for example the additional status of a math function).

 Add to the project one Analog Output function for each additional status not available in the Database.

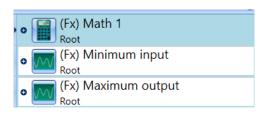


b. Add to the analogue output function the additional status of the math function.






c. Change the name of the Analog Output functions in order to have a clear description of the additional status (es. function_name" + "additional_status").

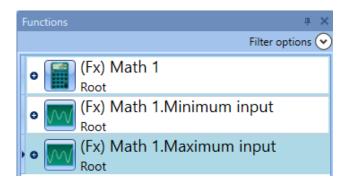

d. In the DB Manager add to the Database the Analog Output function.

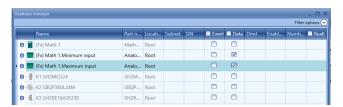


Wrong icons shown in the web App

Problem description

After a firmware upgrade of the system the icons in the web App are not correct (the icons are messed up or missing).

Solution

The error is due to the cache of the web browser, the issue will be resolved cleaning the cache and logging-in again in the web App.

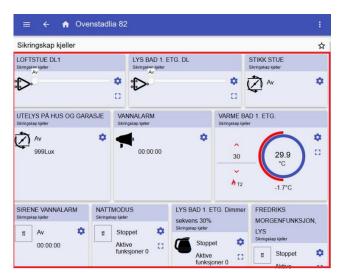



Not possible to scan the DALI network "subnet not found" error message appears

Problem description

After adding the DALI module to the project, from the DALI module discovery window, the user tries to find the ballast connected, but when the search button is pressed, the discovery ends immediately with an error "Subnet not found"




Solution

This is the list of steps to follow to fix the issue

1. Delete the SB2DALI module from the project and add it again after a discovery.



2. Add a multigate function and use the presence diagnostic signal of the DALI module as input signal of the function.

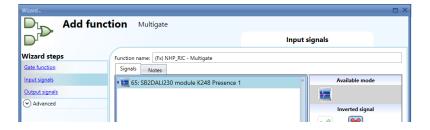

- 3. Write the configuration to the Sx2Web controller.
- 4. When the DALI module is programmed it should be possible to scan the DALI modules from the module "search window".



Dupline temperature regulation function deactivates the heating setpoint

Problem description


When the advanced field Cooling is selected in the Dupline temperature regulation and there is no output signal used, the temperature function activates the cooling set point every time the configuration file is sent to the controller, consequently the heating function goes from heating T1 to TOFF and stops heating.


This problem happens also when the controller restarts because the system loads the configuration at startup and the cooling setpoint is activated.

Solution

In the advanced menu "available output status" the signal temperature regulation. Cooling should be deactivated.

The advanced menu "Cooling" should be unselected.

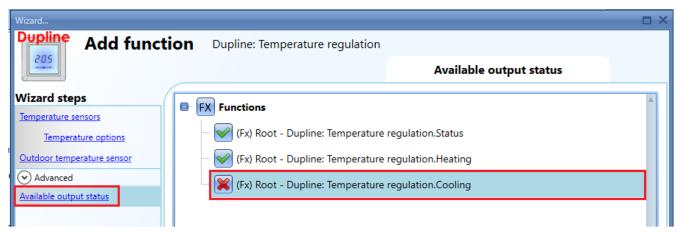

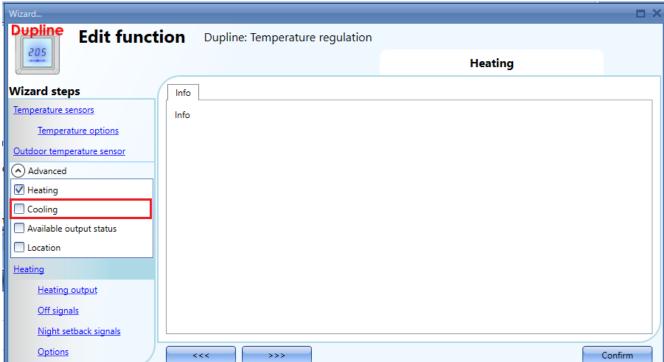



Calendar activities cannot be added


Problem description

When a calendar activity is going to be added either in the *Local calendar* of the functions where it is available in the *Advanced* options, or in the *Global calendar* function, after filling the required fields the *Confirm* button cannot be pressed (this is shown in grey colour).

Solution

This happens if at least one of the following conditions is verified:

Cancel Confirm

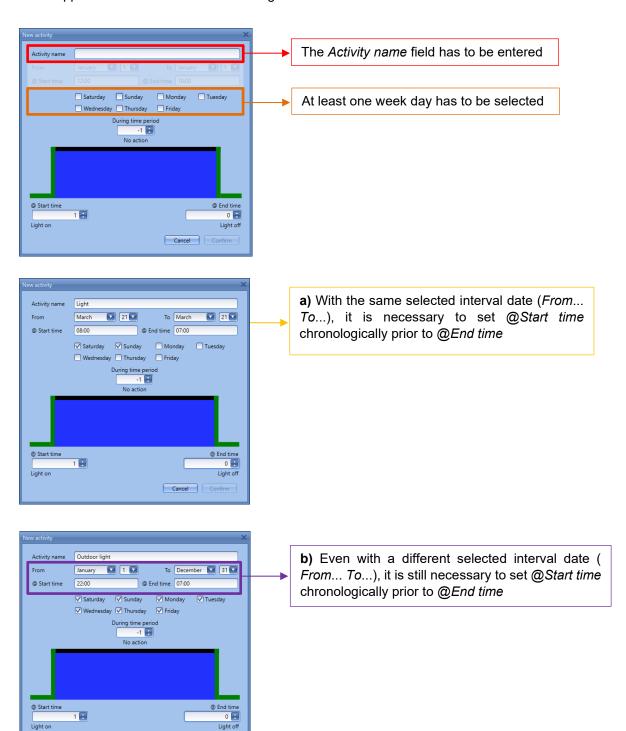



Configuration upload failing – Intruder alarm function and stress lights


Problem description

Configuration upload failing after a modification of the stress light functionality in the intruder alarm function and the system does not work as expected (no error is shown when the software compiles the configuration). This problem occurs every time a light function is added as "stress light" signal in two or more intruder alarm functions.

Solution

It is mandatory to use each light function in one single *stress light* functionality

Note: It is not possible to add the same function in two or more different stress light fields.

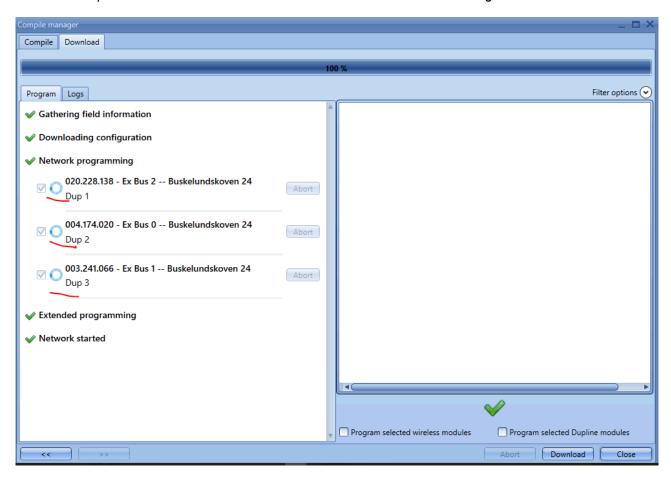




How to add a WEBCAM on ownControl App

To add a WEB CAM, please make sure the device is compliant with ONVIF technology and the RTSP protocol is enabled. The procedure below only shows how to set up a network camera on ownControl App: the camera must be connected and configured on the network before being added to ownControl App.

In the App homepage, tap on then on to access the NEW WEB CAM configuration page.

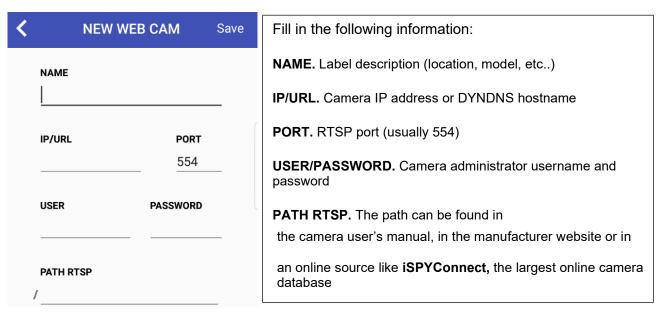

Example 1: Configuration of Webcam HIKVISION DS-2CD2325FWD-I with online reference

Find the RTSP path of the camera model on https://www.ispyconnect.com/sources.aspx
 The RTSP path is shown on the *Path* column (red box below):



- 2. Fill in ONLY the Streaming/Channel/101 path in the PATH RTSP field.
- ⚠ Do not insert the first "/" since it is automatically provided by ownControl App.
- 3. Tap on Save to store the changes.

Example 2: Configuration of Webcam HIKVISION DS-2CD2325FWD-I with Manufacturer reference

- Find the RTSP parameter from the camera <u>User's manual</u>
 Usually, the manufacturers report the complete path that includes username, password, IP address and port.
 Example: rtsp://admin:admin@192.168.0.1:554/ch1/main/av_stream
- 2. Fill in ONLY the ch1/main/av_stream path in the PATH RTSP field.
- Do not insert the information before "ch1/..." since the configuration parameters have to be entered separately in the above-mentioned fields.
- 3. Tap on Save to store the changes.



Download button is not available


Problem description

The *Download* button is not selectable after clicking on the *Send to controller* button from the *Configuration* menu.


This problem occurs every time a pre-compiled configuration is loaded in the *Sx Tool* and the user clicks on the *Send to controller* button without compiling the configuration file.

Solution

1. Do not close the Compile manager window and go back to the previous Compile window

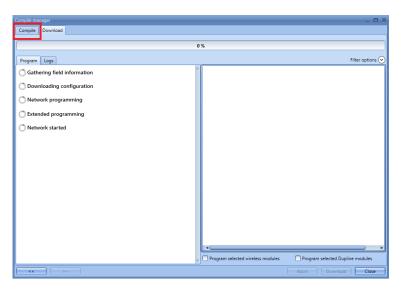

2. Click on the Compile button at the bottom

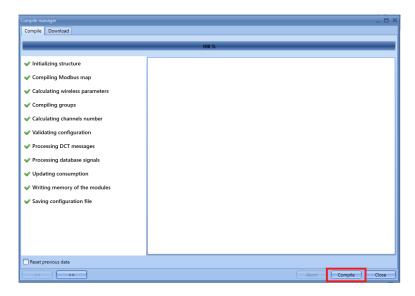


3. The configuration upload will start automatically




Download configuration shows 100% but the modules icons are not updated

Problem description

The *Download* of the configuration leads to an issue in the *Download manager* window: the icons next to the modules keep spinning even if the progress bar shows 100%.

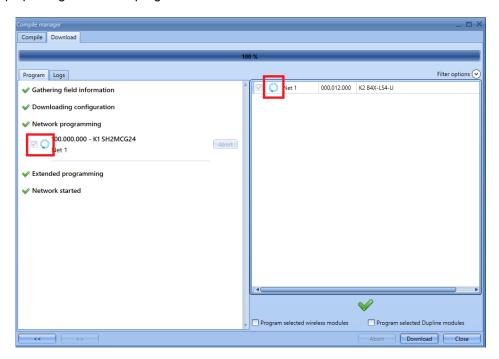

This problem occurs every time a project contains a *Multigate* function that is configured as NAND operator without input signals (the *Input signals* window is empty).

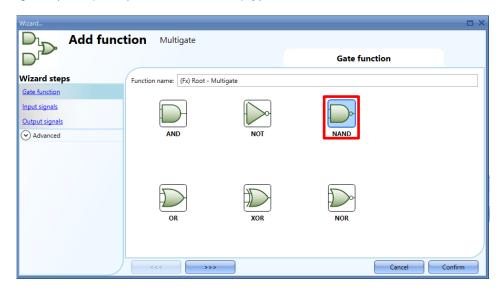

Solution

Delete all the Multigate functions without input signals from the project.